

W_EH_IRE **SURFACE PREPARATION** **EQUIPMENT**

WALL SOCKET
 3 PHASE MAINS
 SUPPLY
 NEEDS TO BE
 5 PIN 32AMP
 OUTLET



32AMP 3PHASE
 5PIN LEAD
 15MTRS LONG



3 PHASE 415V 32AMP 5 PIN
 EXTENSION LEADS,




PHASE INVERTER PLUG FITTED
 TO FLOOR SAW NEEDS TO BE CHANGED
 TO ENSURE CORRECT ROTATION AND
 DIRECTION FOR CUTTING HEAD AND
 THE HYDRAULIC DRIVE SYSTEM TO WORK



CONNECTING 3 PHASE BEF320 SCABBLER TO MAINS SUPPLY FROM WALL SOCKETS IN FACTORY

240V MAINS SUPPLY

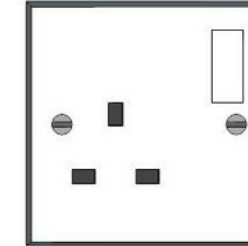

5KVA TRANSFORMER



32AMP 110V LEADS 110V
 EACH ONE IS 14M LONG

SPE 316 DUST
 CONTROL UNIT



5 MTR HOSE FOR
 DUST